



[View products to which this article applies.](#)

Overview

This article contains the release notes for **Intelli-Site v4.0.39.3**. The following sections describe the release in detail and provide late-breaking or other information that supplements the main documentation.



This is a maintenance release that improves quality, reliability, and performance. All users are encouraged to upgrade to this release.

New Features

The following software features were added:

- Driver nodes can be reordered using drag and drop

The following Panels were added or upgraded:

- The icons for Modbus sub-values change depending on the type of integer in the **Value** field. If the value is an integer, the icon is the same as a counter value, . If the value is a bit (e.g., B0-B15) the icon is an I/O Point icon, . The user may need to logoff and login to see the change in icon when the value is changed.

Resolved Issues

The following issues affecting all products have been resolved:

- Desktop Client
 - Design View
 - For screen object properties, when the **Name** of a state is modified, the **Flash To State** drop-down menu immediately reflects the change.
 - Live View
 - A timing issue was discovered in the way Hot Objects were being set. This could affect any command or action that requires at least one previous action to set a Hot Object such as Pelco Switcher commands, or *ForceMask/ForceRoutingMask* actions.
 - Scheduled Events View
 - When the **Name** of an event type is modified and saved, the change is immediately reflected in the Scheduled Events Table for any events of the modified event type.
- Panels
 - Mercury
 - The properties for the **Never** and **Always** Time Zones can be viewed, but cannot be

- modified. They are special Time Zones that must exist and should not ever be modified.
- Modbus
 - The text on the dialog of the *Add Multiple...* context-menu option for the child node of a Value (a.k.a., a sub-value) has changed. **Starting Address** has been changed to **Starting Value** since these are possible values and not locations.
 - When adding sub-value nodes using the *Add Multiple...* context-menu option, one can specify a **Starting Value** for a bit by beginning the number with the letter 'B'. The possible values are B0-B15. Any other values will cause an error. The value must begin with a capital 'B'.
 - The [Cancel] button on the Modbus properties dialog will now abandon changes to all of the **Transaction Type** fields.
 - **Transactions Types** can only be added to *Holding Register* Memory Polling Areas. The **Transaction Types** fields are disabled if the selected Memory Polling Area is not a *Holding Register* Area.
 - The correct **Transaction Types** are displaying for each of the Memory Polling Areas selected in the Modbus properties dialog no matter how many times one opens and closes the properties dialog.
 - New **Transaction Types** can be added and modified regardless of which **Transaction Type** is currently selected.
 - Omron
 - The Panel Guide was updated to include sub-values and the Table of Contents was fixed.

The following issues specific to Intelli-Site Lite have been resolved:

- N/A

Below are issues related to specific OEM versions:

- N/A

Known Limitations

N/A

Products

Applies to:

- Intelli-Site
- Intelli-Site Lite
- LiNC-PLUS
- LiNC-PLUS Lite
- MASC
- MASC Lite
- ResidentGuard

[Go to Top](#)

Copyright © 2016-2019 OSSI, LLC. All rights reserved.

Intelli-Site® is registered in U.S. Patent & Trademark Office. All other registered and unregistered trademarks are the sole property of their respective owners.